

Mark B. Bezilla Vice President - Nuclear 419-321-7676 Fax: 419-321-7582

NP-33-04-002-00

Docket No. 50-346

License No. NPF-3

October 4, 2004

United States Nuclear Regulatory Commission Document Control Desk Washington, D.C. 20555-0001

Ladies and Gentlemen:

LER 2004-002-00

Davis-Besse Nuclear Power Station, Unit No. 1

Date of Occurrence – August 4, 2004

Enclosed please find Licensee Event Report 2004-002-00, which is being submitted to provide written notification of an unplanned reactor trip during Reactor Trip Breaker Testing. This trip occurred due to the presence of a failed fuse in Reactor Trip Breaker "A" circuitry, such that when Reactor Trip Breaker "B" was opened per the test procedure, Reactor Trip Breaker "A" also opened, tripping the reactor. This event is being reported pursuant to 10 CFR 50.73(a)(2)(iv)(A), an event that resulted in actuation of the Reactor Protection System. A 4-hour immediate notification of this event was made to the NRC on August 4, 2004 (Event No. 40921). Commitments associated with this LER are listed in the Attachment.

Very truly yours,

**GMW** 

Enclosure Attachment

cc: Regional Administrator, USNRC Region III
DB-1 Senior Project Manager, USNRC
DB-1 NRC Senior Resident Inspector

Utility Radiological Safety Board

TE22

Docket Number 50-346 License Number NPF-3 NP-33-04-002-00 Attachment Page 1 of 1

## **COMMITMENT LIST**

The following list identifies those actions committed to by the Davis-Besse Nuclear Power Station in this document. Any other actions discussed in the submittal represent intended or planned actions by Davis-Besse. They are described only as information and are not regulatory commitments. Please notify the Director – Performance Improvement (419-321-7181) at Davis-Besse of any questions regarding this document or associated regulatory commitments.

## **COMMITMENTS**

# 1. The Surveillance Test procedures that perform the Channel Functional Test of all four Reactor Trip Breakers were revised to require verification of fuse indication prior to performing the test.

- 2. Additional procedures that may open the Reactor Trip Breakers will be identified and revised as applicable to require verification of acceptable fuse status prior to opening the Reactor Trip Breakers.
- Preventive maintenance activities will be developed to replace the fuses associated with the Control Rod Drive System Source Interruption Devices on a periodic basis to preclude failure due to age and/or weakening due to long term cycling.

## **DUE DATE**

- 1. Completed August 17, 2004
- 2. December 5, 2004
- 3. November 15, 2004

(6-2004)	RM 3	366	U.S	. NUCLI	AR R	EGULA	TORY C	ОММІЅ			ED BY OMB NO. 3		_		_	/30/2007
(5-2004)	L		ee reverse	e for requ	uired r	number (	•	2)	re lic es N e- ar Bi	quest: 50 pensing prostimate to uclear Remail to Independent to the conduction of the conduction description of the conduction of the cond	burden per respoid ons. Reported ones and fed back the Records and guiatory Commissi focollects@nrc.gov tory Affairs, NEOB ashington, DC 2050 oes not display a cut or sponsor, and collection.	lessons leak to Industry. S FOIA/Privacy on, Washingto, and to the D -10202 (3150-103). If a mear urrently valid O	med are in Send comme Service Bra n, DC 20555 Desk Officer, 0104), Office as used to in MB control n	corpo nts re inch ( i-0001 Office of Ma ipose umbe	rated gardin T-5 F i, or b e of In anage an in r, the I	Into the g burden 52), U.S. y internet formation ment and formation NRC may
1. FACIL	LITY		digits/char	acters to	reaci	1 DIOCK)	<del></del>				ET NUMBER	] 3	. PAGE			
Davi	s-Be	sse Uni	t Numbe	er 1	_				]_	05	000346		1	OF	4	
4. TITLE Reac		Γrip Duri	ng Read	ctor Tri	p Bre	aker 1	resting	Due T	o Fuse	Failur	е					
5, EV	ENT	DATE	6.	LER NU			7. RE	PORT	DATE			R FACILITII	ES INVOL			
MONTH	DAY	YEAR	YEAR	SEQUEN NUMBE		REV NO.	монтн	DAY	YEAR	FACILIT					)500	
08	04	2004	2004	- 002	2 -	00	10	04	2004	FACILIT	Y NĂME				)500	NUMBER )0
9. OPER	ATIN	G MODE	20.22 20.22 20.22 20.22	201(b) 201(d) 203(a)(1) 203(a)(2)	(i)		20.220 20.220 20.220 50.36	03(a)(3)( 03(a)(3)( 03(a)(4) (c)(1)(l)(	(i) (ii) A)		EQUIREMENT  ] 50.73(a)(2)(i)  ] 50.73(a)(2)(ii  ] 50.73(a)(2)(ii  ] 50.73(a)(2)(ii	)(C) )(a) )(B) i)	50.73	i(a)(2 i(a)(2 i(a)(2 i(a)(2	2)(vii) 2)(viii 2)(viii 2)(viii 2)(ix)	)(A) )(B)
10. POW	100		20.22 20.22	203(a)(2) 203(a)(2) 203(a)(2) 203(a)(2) 203(a)(2)	(iii) (iv) (v)	] ] ] ]	50.36( 50.46( 50.73(	(c)(1)(ii)( (c)(2) (a)(3)(ii) (a)(2)(i)( (a)(2)(i)(	A)	<u>ם</u> ב ב	<ul> <li>         ∑ 50.73(a)(2)(iv         ) 50.73(a)(2)(v         ) 50.73(a)(a)(2)(v         ) 50.73(a)(a)(a)(a)(a)(a)(a)(a)(a)(a)(a)(a)(a)(</li></ul>	r)(A) r)(B) r)(C)	50.73 73.71 73.71 OTHI Specii	(a)(4 (a)(5 ER fy in A	f) 5) Abstra	ct below
						12. L	CENSEE			THIS						
FACILITY	NAME					otory C	Complia	nce				1	NE NUMBER 321-800		ude Ar	ea Code)
Geraid	M. V	Wolf, St	aff Engi	neer, R	egui	atory C	Joinpila					J (419) (	321-000	1		1
Geraid	M. \				IE LIN	IE FOR	EACH C	OMPON	ENT FA	LURE	DESCRIBED IN	<del></del>	ORT			
CAUSE			3. COMP		NE LIN		<u>.</u>	OMPON ABLE	CAU		SYSTEM	<del></del>	ORT			ORTABLE DEPIX
		1	COMP	LETE ON	NE LIN	IE FOR	EACH C	OMPON ABLE				THIS REP	ORT MANU			
CAUSE		SYSTEM JC	COMPI	LETE ON PONENT FU EMENTA	FACT GI	NE FOR ANU- TURER 080 PORT E	REPORTATION TO EF	OMPON ABLE PIX				COMPONENT COMPONENT ECTED SSION	ORT MANU		T(	
CAUSE X	(If ye	JC	COMPI COMP F S. SUPPLI	EMENTA	GUAL RE	NE FOR ANU- TURER 080 PORT E	REPORTATION FOR THE PROPERTY OF THE PROPERTY O	OMPON ABLE PIX	CAU NO	SE	SYSTEM  15. EXPE SUBMIS DAT	COMPONENT COMPONENT ECTED SSION	ORT MANU- FACTUR	€R	T(	EPIX

NRC FORM 366 (6-2004)

# LICENSEE EVENT REPORT (LER)

1. FACILITY NAME	2. DOCKET		3. PAGE		
Davis-Besse Unit Number 1	05000046	YEAR SEQUENTIAL REVISION NUMBER			2054
	05000346	2004	002	00	2 OF 4

17. NARRATIVE (If more space is required, use additional copies of NRC Form 366A)

#### **DESCRIPTION OF OCCURRENCE:**

On August 4, 2004, with the plant in Mode 1 operating at approximately 100 percent power, quarterly surveillance testing was in progress on the Reactor Trip Breakers and Reactor Protection System (RPS) [JC] utilizing procedure DB-MI-03011, "Channel Functional Test of Reactor Trip Breaker B, RPS Channel 1 Reactor Trip Module Logic and ARTS Channel 1 Output Logic." In accordance with the surveillance test procedure, technicians placed Reactor Trip Module (RTM) Reactor Protective Channel Switches A and B to the "SIMULATE TRIP" position. When the second switch was placed in the "SIMULATE TRIP" position, a reactor trip occurred at 1023 hours.

Unit response to the reactor trip was as designed. Plant parameters stabilized within their normal post-trip values. One Main Steam Safety Valve (MSSV) [SB-RV], SP17A9 continued to lift following the reactor trip at a value less than its setpoint of 1100 psig. Operators lowered Steam Generator 2 pressure to approximately 970 psig in order to allow SP17A9 to reseat.

Initial notification of this automatic reactor trip was made to the NRC at 1114 hours on August 4, 2004, in accordance with the four-hour reporting requirement of 10CFR50.72(b)(2)(iv)(B) (Event Number 40921). This report is being submitted in accordance with the 10CFR50.73(a)(2)(iv)(A) as an event that resulted in actuation of the Reactor Protection System.

## APPARENT CAUSE OF OCCURRENCE:

Electric power to the Control Rod Drives (CRDs) and Motors [AA] is supplied by redundant power channels, and the Reactor Trip Breakers are arranged such that breaker "A" or "C" AND "B" or "D" must be open to remove power from the CRDs. When Reactor Trip Breaker "B" was opened as part of the surveillance test, Reactor Trip Breaker "A" also opened unexpectedly removing power to the CRDs allowing the Control Rods to insert into the Reactor Core.

Reactor Trip Breaker "A" opened due to a fuse failure in a circuit designed to open the breaker when an undervoltage condition is detected on either redundant CRD System power channel. The circuit, part of the Source Interruption Device (SID) installed in both Reactor Trip Breakers "A" and "B", receives undervoltage detection input from both redundant CRD power channels. Refer to Figure 1 for a simplified functional diagram of the CRD circuitry. The fuse in the Reactor Trip Breaker "A" power channel undervoltage detection input that receives power from Reactor Trip Breakers "A" and "C" had failed prior to the test, leaving the Reactor Trip Breaker "A" Source Interruption Device in a half-tripped condition. When Reactor Trip Breaker "B" was opened as intended during the test, input from Reactor Trip Breaker "B" supplied power channel into the Reactor Trip Breaker "A" Source Interruption Device also depowered, indicating an undervoltage condition. With both inputs indicating an undervoltage condition, the Source Interruption Device responded as designed, initiating a shunt trip of Reactor Trip Breaker "A", which resulted in a trip of the reactor due to the depowering of the remaining CRD power source.

While the Reactor Trip Breaker Source Interruption Device fuses are equipped with failed fuse indicator lights that can be observed when the Reactor Trip Breaker cubicle is opened, surveillance test procedure DB-MI-03011 contained no procedural check to determine the status of these fuses prior to test performance. The fuse in Reactor Trip Breaker "A" Source Interruption Device was determined to have failed due to age and fatigue.

# LICENSEE EVENT REPORT (LER)

1. FACILITY NAME	2. DOCKET	1	3. PAGE			
Davis-Besse Unit Number 1	05000240	YEAR	YEAR SEQUENTIAL NUMBER		2.05.4	
	05000346	2004	002	00	3 OF 4	

17. NARRATIVE (If more space is required, use additional copies of NRC Form 366A)

### ANALYSIS OF OCCURRENCE:

There were no safety concerns identified during or as a result of this event. When the Control Rod Drive Trip Breakers opened, all Control Rods inserted. The Steam Generator outlet pressure increased due to the closing of the Main Turbine Stop Valves [TA-ISV]. The Turbine Bypass Valves (TBVs) [SB-PCV] and the Atmospheric Vent Valves (AVVs) [SB-PCV] opened and the MSSVs lifted in response to the increasing secondary system pressure. The MSSVs (except for SP17A9 as described above) and the AVVs closed as Steam Generator outlet pressure decreased. The Safety Features Actuation System [JE] was not challenged during this event, and there were no significant deviations in Reactor Coolant System pressure, temperature, or inventory control; or in Steam Generator pressure or inventory control.

#### CORRECTIVE ACTIONS:

The failed fuse in Reactor Trip Breaker "A" was replaced, along with the remaining fuses associated with the Source Interruption Device supply circuits as a preventative measure for age/weakening.

The Surveillance Test procedures that perform the Channel Functional Test of all four Reactor Trip Breakers were revised to require verification of fuse indication prior to performing the test. Additional procedures that may open the Reactor Trip Breakers will be identified and revised as applicable by December 5, 2004, to require verification of acceptable fuse status prior to opening the Reactor Trip Breakers.

Preventive maintenance activities will be developed by November 15, 2004, to replace the fuses associated with the Control Rod Drive System Source Interruption Devices on a periodic basis to preclude failure due to age and/or weakening due to long term cycling.

## **FAILURE DATA:**

There have been no Licensee Event Reports at the Davis-Besse Nuclear Power Station involving a reactor trip caused by a fuse failure in the previous three years. While the discovery of failed open fuses is a relatively common event, there has been no actuation of engineered safety feature equipment at the Davis-Besse Nuclear Power Station as a result of a failed fuse in the past three years.

Energy Industry Identification System (EIIS) codes are identified in the text as [XX].

NP-33-04-002-00 CR 2004-04927